

febi 45158**45600, 46099, 47673, 47797**

To fit:

Fiat Ducato, Iveco Daily 2.3 & 3.0 Diesel



febi 47797



febi 45600

Throttle Body

Problem

Reduced performance with the vehicle in limp home mode, throttle body not functioning, fault code 'P0638 throttle actuator control range / performance' logged in the engine control unit.

Cause

Early models can suffer from water ingress into the electrical connectors of the connecting cable and throttle body. This causes corrosion of the wiring loom connector and connector pins, resulting in a loss of connectivity. Moisture can also damage the throttle body control through corrosion, eventually leading to component failure.

Solution

Replace faulty throttle body and connector cable as required.

For the vehicles listed above, throttle valves with reference numbers 7523D and 7497D were installed from the start of series production.

The vehicle manufacturer changed the supplier of these parts in 2009. Consequently, an adapter cable is required for throttle body replacement on pre-2009 vehicles.

For a comprehensive solution **febi Throttle Body kits** 47797 and 45600 come complete with the connection cable and gasket.

Alternatively, febi Adapter Cable for throttle body 47673 and 46099 are available as separate items.

For more technical information please visit: partsfinder.bilsteingroup.com